


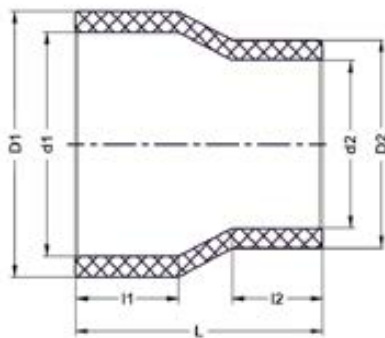

Муфта переходная для стыковой сварки РР-Н IPS (Model A) 40x20 PN10

Артикул	Размер	PN	D1	d1	D2	d2	L	l1	l2
IRBM11020016	20x16	10	20	15	16	13,2	50	20,2	19,8
IRBM11025020	25x20	10	25	19,9	20	15	50	20,3	19,8
IRBM11040025	40x25	10	40	32,6	25	19,9	55	25,5	20
IRBM11050020	50x20	10	50	40,8	20	15	60	26	20,2
IRBM11050025	50x25	10	50	40,8	25	19,9	60	26	19,8
IRBM11063020	63x20	10	63	51,4	20	19,9	65	29,3	20
IRBM11063025	63x25	10	63	51,4	25	19,9	65	29,8	19
IRBM11063032	63x32	10	63	51,4	32	26	65	30,5	26,5
IRBM11063050	63x50	10	63	51,4	50	40,8	65	30	25,8
IRBM11090075	90x75	10	90	73,6	75	61,2	161	76	55
IRBM11110090	110x90	10	110	90	90	73,6	180	80	70
IRBM11032020	32x20	10	32	26	20	15	50	25,4	19,8
IRBM11063040	63x40	10	63	51,4	40	32,6	65	30,2	25,4
IRBM11075063	75x63	10	75	61,2	63	51,4	147	67	50
IRBM11040020	40x20	10	40	32,6	20	15	55	25,5	20
IRBM11075050	75x50	10	75	61,2	50	40,8	147	67	50
IRBM11040032	40x32	10	40	32,6	32	26	55	26	25,5
IRBM11110075	110x75	10	110	90	75	61,2	180	79	70
IRBM11050040	50x40	10	50	40,8	40	32,6	60	26	26,3
IRBM11090063	90x63	10	90	73,6	63	41,4	162,5	76	55
IRBM11090050	90x50	10	90	73,6	50	40,8	161	76	55
IRBM11050032	50x32	10	50	40,8	32	26	60	26	25
IRBM11032025	32x25	10	32	26	25	19,9	50	25,4	20
IRBM11110063	110x63	10	110	90	63	51,4	180	79	70