


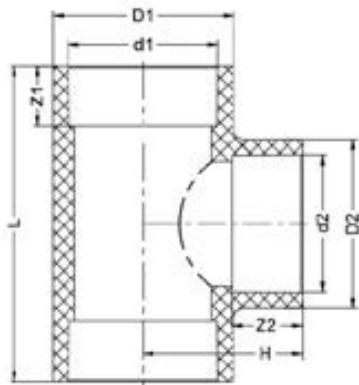

Тройник переходной для раструбной сварки 90° PP-H IPS 75x32 PN10

Артикул	Размер	PN	DN	D1	D2	d1	d2	L	H	Z1	Z2	Бес
ITRIM025020	25x20	10	20x15	35	29	25	20	60	29	18	15	0,03
ITRIM032020	32x20	10	25x15	43	29	32	20	64	32	20	15	0,05
ITRIM040032	40x32	10	32x25	51	43	40	32	80	42	22	20	0,08
ITRIM050032	50x32	10	40x25	64	43	50	32	86	48	24	20	0,12
ITRIM063032	63x32	10	50x25	81	43	63	32	94	54,5	28	20	0,20
ITRIM063050	63x50	10	50x40	81	64	63	50	112	58,5	28	24	0,25
ITRIM075040	75x40	10	65x32	93	51	75	40	111	63	31	22	0,28
ITRIM090075	90x75	10	80x65	114	93	90	75	155	80,5	35	31	0,64
ITRIM110050	110x50	10	100x40	134	64	110	50	146	84	41	24	0,71
ITRIM110063	110x63	10	100x50	134	81	110	63	159	88	41	28	0,79
ITRIM032025	32x25	10	25x20	43	35	32	25	68	35	20	18	0,05
ITRIM040020	40x20	10	32x15	51	29	40	20	70	37	22	15	0,06
ITRIM050025	50x25	10	40x20	64	35	50	25	80	46	24	18	0,11
ITRIM075063	75x63	10	65x50	93	81	75	63	134	69	31	28	0,37
ITRIM090050	90x50	10	80x40	114	64	90	50	132	73,5	35	24	0,52
ITRIM110090	110x90	10	100x80	134	114	110	90	183	95	41	35	0,97
ITRIM050020	50x20	10	40x15	64	29	50	20	76	43	24	15	0,10
ITRIM040025	40x25	10	32x20	51	35	40	25	74	40	22	18	0,07
ITRIM050040	50x40	10	40x32	64	51	50	40	94	50	24	22	0,14
ITRIM063040	63x40	10	50x32	81	51	63	40	102	56,5	28	22	0,22
ITRIM075032	75x32	10	65x25	93	43	75	32	103	61	31	20	-
ITRIM075050	75x50	10	65x40	93	64	75	50	121	65	31	24	0,32
ITRIM110075	110x75	10	100x65	134	93	110	75	169	91	41	31	0,85
ITRIM090063	90x63	10	80x50	114	81	90	63	145	77,5	35	28	0,59